


# TURBINE DROP CABLE ASSEMBLY


CABLE SPECS:  
- 4 CONDUCTOR  
- 14 OR 12 AWG  
- JACKET O.D. 0.54" TO 0.73"



STEP 1: INSTALL CORD GRIP

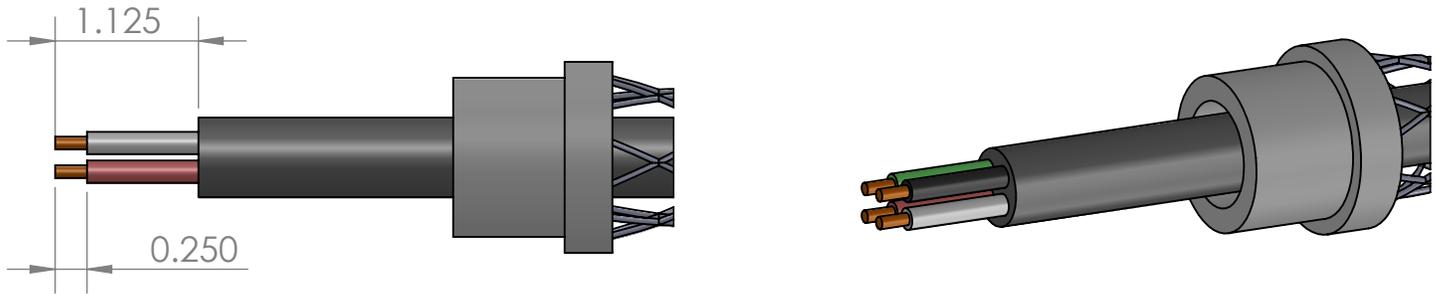


STEP 2: STRIP JACKET & CONDUCTOR

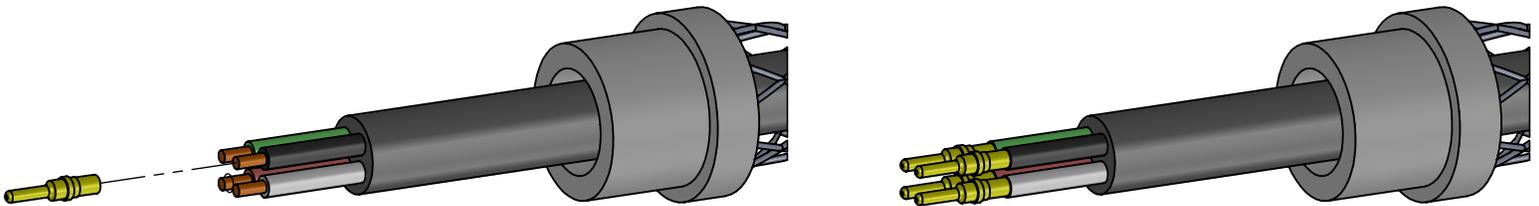


STEP 3: CRIMP ON PINS  
MUST USE CRIMPER M22520/1-01 AND TURRET M22520/1-02

GROUND CONDUCTOR MUST  
BE INSTALLED INTO  
CONNECTOR POSITION "D"

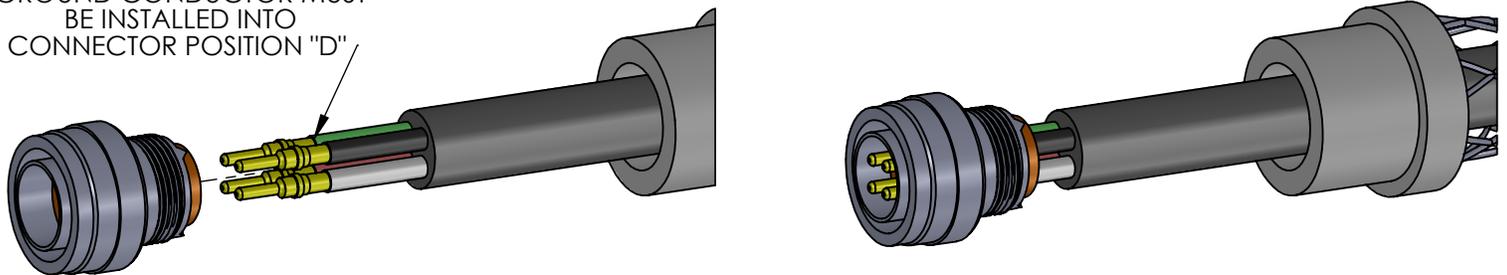

STEP 4: INSTALL CONNECTOR  
EACH PIN MUST BE FULLY INSERTED UNTIL CLICK IS FELT

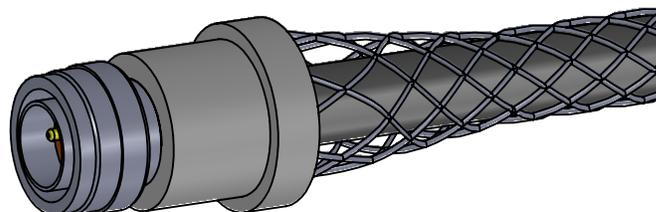

STEP 5: TIGHTEN CORD GRIP